

# Magnetic Particle Accessories

## Magnetic Particle Equipment Cables, Adapters and Accessories

Adapters and add-on accessories expand the capabilities of standard magnetic particle equipment. Every application has unique requirements, and these specially designed adapters make magnetization easier.



### CABLES

4/0 cables are essential for P-series, M-series, and CSV-series power packs. Cables can be used to flow magnetizing current through a large part or structure, or wrapped around pipes and long weldments for longitudinal magnetization. Magnaflux 4/0 cables are available in standard welding grade or heavy-duty grade with extra insulation and tinned conductors. Cables are factory terminated in a variety of lengths and a choice of standard lug connections or heavy-duty quick connect fittings. Custom-length cables are also available – please contact Magnaflux Customer Service for quotation.

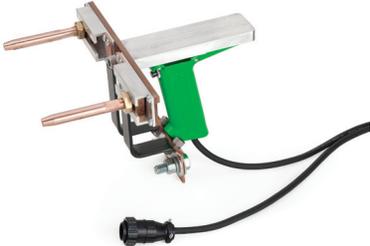
Cable	Description	Length	Part number
	4/0 cable assembly with two 626342 lug connectors on each end	15 ft / 4.6 m	626350-180
		20 ft / 6.1 m	626350-240
		Custom length	626350-xxx Contact customer service
	4/0 cable assembly with 628828 QC-F and 628829 QC-M quick connectors on each end	15 ft / 4.6 m	628833-180
		20 ft / 6.1 m	628833-240
		Custom length	628833-xxx Contact customer service
	Lug to Lug	Custom length	626500-xxx Contact customer service

Connector	Description	Part number
4/0 Lug 	Standard 4/0 cable termination	626342
QC-M 	Male Quick connect 4/0 cable termination (used with QC-F)	628829
QC-F 	Female Quick connect 4/0 cable termination (used with QC-M)	628828

Adapter	Description	Part number
Lug-QC Adapter Kit 	Set of two adapters, 12 in / 30 cm long. Standard 4/0 lug to QC-M and Standard 4/0 lug to QC-F, one each. Used in combination with prods, connectors and cable wraps to provide modularity in magnetizing techniques.	628832

## PRODS & CONNECTORS

When using P-series, M-series, and CSV-series power packs, effective magnetization depends on secure contact with the part or structure being examined. Connections can be made in a variety of ways depending on the specific needs of the application.

Connector	Description	Part number
<p data-bbox="115 451 451 483">Standard Contact Clamp</p> 	<p data-bbox="673 451 1185 569">Spring-loaded clamp with braided copper contact and lug connection. Used for smaller structures and parts up to 2.5 in / 6.4 cm diameter.</p>	<p data-bbox="1245 451 1450 609">Clamp: 1865A Replacement copper braid: 14710</p>
<p data-bbox="115 842 488 873">Heavy-Duty Contact Clamp</p> 	<p data-bbox="673 842 1208 959">Large C-Clamp with leaded copper braid contact pad and double lug connections. Used for large structures and parts up to 7 in / 18 cm diameter.</p>	<p data-bbox="1245 842 1352 873">169802</p>
<p data-bbox="115 1241 370 1272">Standard Prod Set</p> 	<p data-bbox="673 1241 1185 1392">Set of two hand-held electrodes with mag shot trigger and 4/0 lug connections. Solid copper tips 0.375 in / 9.5 mm diameter, 3.75 in / 95 mm long.</p>	<p data-bbox="1245 1241 1507 1314">P-Series: 157662 M-Series: 622088</p>
<p data-bbox="115 1623 310 1654">Dual Prod Set</p> 	<p data-bbox="673 1623 1208 1801">Single hand-held set with two electrodes, mag shot trigger and 4/0 lug connections. Adjustable electrode spacing with 3.875-8.125 in / 9.8-20.6 cm range. Solid copper tips 0.375 in / 9.5 mm diameter, 3.75 in / 95 mm long.</p>	<p data-bbox="1245 1623 1507 1696">P-Series: 157781 M-Series: 622499</p>

**WET BENCH ADAPTERS**

Expand the capabilities of standard wet bench equipment for examination of multiple small parts or large structures. These adapters maximize the number of parts that can be inspected using a single piece of equipment.

Adapter	Description	Part number
Central Conductor Kit 	Solid copper rods 18 in / 45.7 cm long for circular magnetization (head shot) of rings and hollow parts. Set of three diameters: 0.50 in / 12.7 mm, 0.75 in / 19.0 mm, 1.00 in / 25.4 mm	622639
Small Parts Adapters 	Copper contact blocks mounting directly to the head and tail stock providing small contacts (1.00 x 1.25 in / 25.4 x 31.8 mm) for direct magnetization of small components. Adjustable V-block for pins and bolts.	Headstock: 28470 Tailstock: 28471
Flat Coil 	Sealed lateral coil, mounts between head and tail stock to provide indirect magnetization. Wide flat surface for inspection of multiple small components. Parts can be arranged in line for circular magnetization or across the coil for longitudinal magnetization. 20 in / 51 cm long, 6.75 in / 17 cm wide, 44 Lb / 20 kg. Includes two handles for loading and unloading.	611700
Steady Rests 	Single hand-held set with two isolated rollers that mount directly to the equipment to stabilize and support long, heavy parts such as crankshafts during the inspection process. Adjustable height to accommodate different shaft diameters. Capacity up to 1500 Lb / 630 kg.	Headstock: 605750 Tailstock: 621658 Rail-Mount: 1857
Contact Block 	Adapter clamped between head and tail stock provides lug terminals to connect 4/0 cables for remote magnetization.	Headstock: 1830

### REMOTE CONTROLS

Remote control cables for P-Series and M-Series power packs allow the inspector to trigger mag shots and adjust amperage settings at the examination site.

Remote	Description	Part number
<p>P-Series Remote</p> 	<p>Remote switch for triggering a mag shot, 15 ft / 4.6 m long.</p>	<p>626797</p>
<p>Remote Palm Button</p> 	<p>Remote mag shot button for use with the Mag Kit and P-Series power packs. Mounts directly to the side of the Mag Kit bench.</p>	<p>169621</p>
<p>M-Series Pendant</p> 	<p>Remote control box provides full control of M-Series power pack at the examination site. Includes waveform selection, amperage adjustment, and mag/demag triggers. 15 ft / 4.6 m long.</p>	<p>626120</p>